

TECHNICAL SERVICE BULLETIN

To: All PowerBoss Dealers and Service Managers

From: PowerBoss Technical Support

Date: 3/14/2013

Subject: GM Exhaust manifold gasket update

Reason for Change

Improve the reliability of the donut gasket connection

Improvement

Enhanced design to allow exhaust connection to flex with new bolts and springs

Models/Serial Numbers Affected

Models: All Monitors and Commanders with GM 1.6 engines

Serial number(s) effected: All before 19810033

Reference Kit Instructions – This is only to be done should existing nuts come loose or donut gasket fails. Parts and labor should be submitted through the warranty claim process.

Order and install part number (2) 3344568 (Bolt and Springs) and (1) 3343069 (Donut Gasket)

Remove old bolts and nuts, install new bolts, slide springs on the bolts, insert the donut gasket in the exhaust pipe. Align the pipe to the bolts with the spring between it and the engine manifold and tighten the nuts to the end of the threading on the bolt. Reference pictures below. Should you have any questions, feel free to contact Technical Support.

Informational Only For Purchase Warranty



For further assistance, questions, or comments contact Technical Support at 800-982-7141 (USA)