

TECHNICAL SERVICE BULLETIN

To: Dealers/Technicians

From: Minuteman Technical Support

Date: 6/11/2020

Subject: TSB-ECN151063 – New diode Added on Scrub Relays

Reason for Change

The scrub control relay may, in some cases cause damage to the switch inside the throttle pedal.

Improvement

The diode added to the relay. The diode acts as surge protector for the switch, located inside the throttle pedal.

Models/Serial Numbers Affected

Models: All versions of A-MR20DQP, A-MR20DSQP, A-MR26DQP, A-MR26DSQP MR20SWQP, MR28OQP, MR28OQP.

Models built before 02/15/2020 and before serial number 20020390, may need the diode added.

All models listed above, that are newer or built after serial number 20020390, will have diode installed from the factory.


Reference Instructions – Order diode part number 740482 along with the throttle pedal 748507, when replacing, if the brush switch inside the throttle has failed.

Note: Warranty only applies to the machines that are still under the original factory warranty.

Note: This is not a recall. Install diode only, if the throttle pedal has failed.

For Installation Procedure. See below.

Informational Only

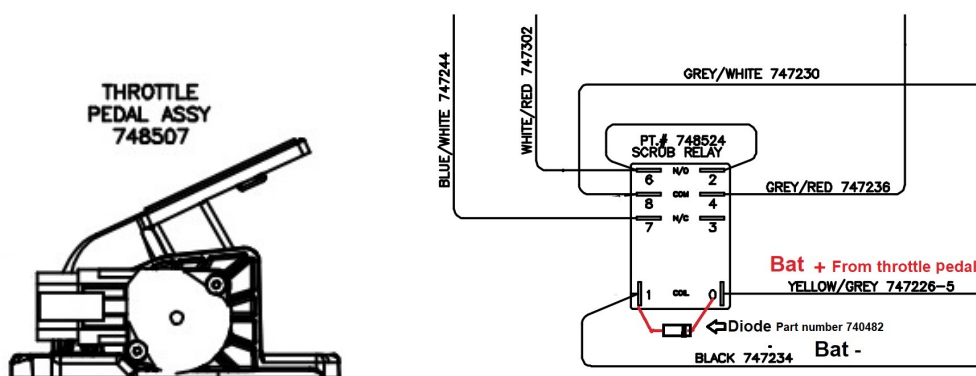

For further assistance, questions, or comments contact Technical Support at 800-982-7141 (USA)