

## TECHNICAL SERVICE BULLETIN

---

To: [Distributor/Customer]

From: PowerBoss Technical Support

Date: 8/29/2022

Subject: Preventative Maintenance on the Chemical Dosing Pump on the Scrubmaster B175R and B260R series scrubber, part #01375900.




### **Models/Serial Numbers Affected**

Scrubmaster B175R and B260R

---


### **Reason for Maintenance**

Non-Usage or allowing chemical residue to lay static in flow hose can cause blockage or hose collapse.

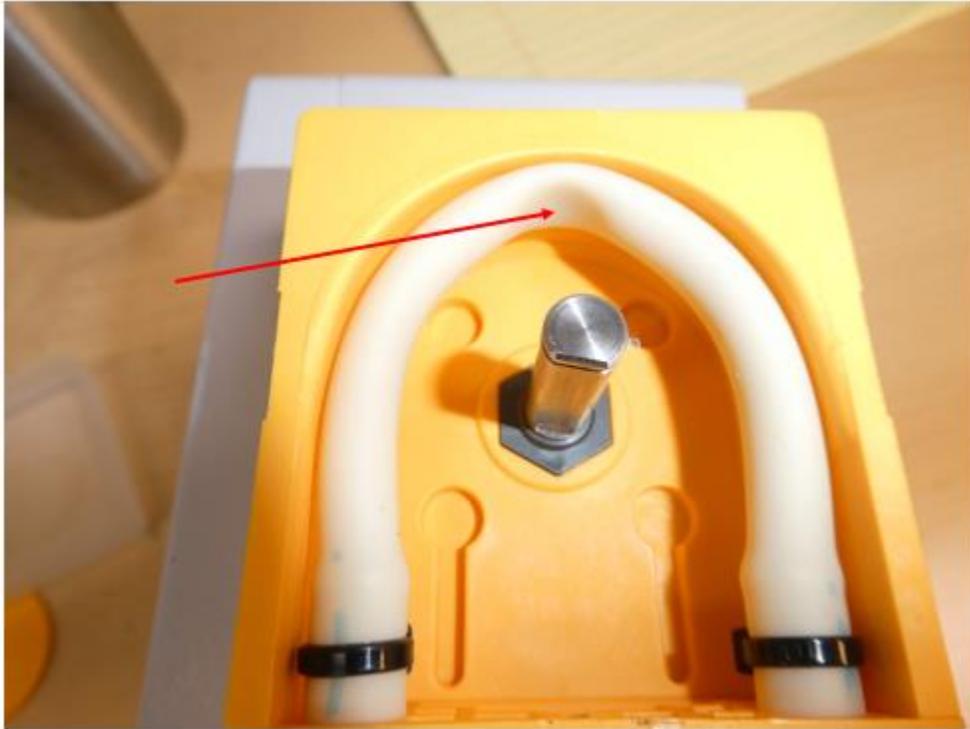

### **Action to be Taken**

- 1) Remove clear cover and yellow cam cover.

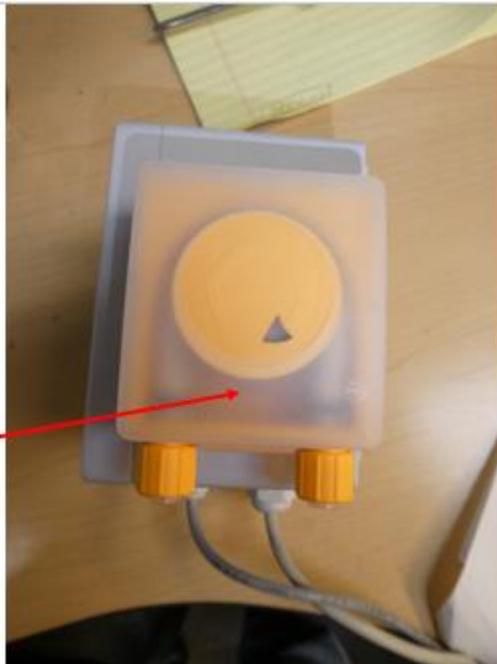

- 2) Remove Cam, zip ties and feed hose.



- 3) Once hose is removed wash and rinse out with white vinegar and massage kink out of affected area, reassemble and return to service.



---

### **Maintenance Interval**

Should be done every 200 machine hours.

**Informational Only**    For Purchase    Warranty    Product Improvement